

## Fermi National Accelerator Laboratory

Technical Division-Machine Shop

## **Welding Procedure Specification**

	Welding Procedure Specification No.: Fermi WPS SS-2-001 Date: 1/15/2010							
Revision No.: R-1	Revision Date: 8/31/2010	Remarks: Revised amperage & voltage range, added 1/16Ø to Tungsten Electrode.  Correction of errata		porting PQR No.(s): ni PQR SS-2-001				
Welding Processes: (1)Type: GTAW/Manual (2)Type:								
		(Manual, Automatic, Machine, Semi-automatic)		19				

Joints (QW-402):	···		
Joint Design: Square Groove	Backing: Gas	Backing Material (Type) Root: Argon Gas	Remainder:
Retainer: Yes *** No		tallic *** Metallic (Non-fusing	<del>, , , , , , , , , , , , , , , , , , , </del>
		Joint Details: SA 240 Type 304 Plate 1 G	.105
#6 gas cup 3/32Ø EWTh-2		0-1/16 Root	s

Base Metals (QW403):	P-No.: 8,	Gp. 1		To	P-No.:	8, Gp. 1	·· <b>-</b> ··
Specification Type and G	rade: SA 240 Ty	pe 304				-	<u> </u>
TO Specification Type an	d Grade: SA 240	Type 304		•		•	
OR Chemical Analysis an	d Mechanical Prop	erties:					
TO Chemical Analysis an							
Thickness Range:		Process	1			P	rocess 2
Base Metal:	Groove: .105"2	210"	Fillet:	Unlimit	ed	Groove:	Fillet:
Deposited Weld Metal:	Groove: .105"2	210"	Fillet:	Unlimit	ed	Groove:	Fillet:
Pipe Diameter Range:	Groove: 2.875"	Minimum	Fillet:	Unlimit	ed	Groove:	Fillet:
Other:		25	_				<u> </u>

Filler Metals (QW-404)	Proce	ss 1	Process 2		
Specification No. (SFA):	Autogenous No Filler				
AWS No, (Class):					
F-No.:		<u>.</u>		· · · · · · · ·	
A No.:	8	••			
Size of Filler Metals:					
Deposited Weld Metal	Groove: 105"-210"	Fillet: Unlimited			
Thickness Range:	Groove: .105"210"	Fillet: Unlimited	Groove:	Fillet:	
Electrode-Flux (Class):		-			
Flux Trade Name:					
Consumable Insert:					
Other:			. L.		

Each Base Metal-Filler Metal Combination should be recorded individually

Use of Fermilab Welding Procedures and Welder Qualifications for non-Fermilab work shall be at the sole risk and responsibility of the Subcontractor, and the Subcontractor shall indemnify and save Fermilab and the government harmless from any and all claims, demands, actions or causes of action, and for any expense or loss by reason of Subcontractor's and their employees possession and use of Fermilab procedures and qualifications.



## Fermilab Fermi National Accelerator Laboratory Technical Division-Machine Shop

## **Welding Procedure Specification**

Positions (QW-405		Post Heat Treatment (QW-407)		
Positions of Groove:	1 G Flat	Temperature Range:	None	
Welding Progression		Time Range	N/A	
Positions of Fillet	All			

Preheat (QW-408)	Gas (QW-408)				
Preheat Temperature:	Minimum 50° F			% Composition	
Interpass Temperature:	Maximum-Not Recorded		Gases	Mixture	Flow Rate
Preheat Maintenance:	None	Shielding	Argon	99.9%	15-20 CFH
Minimum Welding Temperature	50° F	Trailing	None	***	***
		Backing	Argon	99.9%	15-20 CFH

Electrical Characteristics (QW-409)									
Current - AC or DC:	Direc	ct Current	Polarity:	Straight	Characteristics	Non-Pulsing			
Tungsten Electrode:	Size:	1/16"Ø -3/32	2ӯ **	EWTh-2					
Mode of Metal Transfer for GMAW	N/A			<del></del>					
Electrode Wire Feed Speed Range:	N/A								

Technique (QW-410)		<del></del>			
String or Weave Bead:	String				
Orifice or Gas Cup Size:	#5 or #6 Gas Lens				
Initial Interpass Cleaning (Brushing	, Grinding, etc.):	Initial Solvent Clean***Wire brush/file burrs if present			
Method of Back Gouging:	None	The state of the s			
Oscillation: None					
Contact Tube to Work Distance:	N/A				
Multiple or Single Pass (per side):	Single				
Multiple or Single Electrode(s):	Single				
Travel Speed (Range):	As Required/see sequence	chart			
Peening:	None				
Other:					
	<del></del>				

Sequence	Chart:		<del></del>	<u></u> "			<del></del>	<del></del>
		Filler Meta	er Metal Current		rrent		Travel	Other
Weld				Type	Amperage	Voltage	Speed	(Power Source)
Layers	Processes	Class	Ø	Polarity	Range	Range	Range	(Special Requirement)
1 Final	GTAW	Autog	enous	DCEN	65-95*	10-15*	As Required	Miller Dynasty DX
								#4173 Power Source
								with Remote Foot Pedal
_	<u> </u>							Control
-	<u> </u>							Maintain Argon
								coverage on back side
								throughout weld-Use
								alignment and purge
· . <u></u>		<u></u> <u> </u>						fixture

Use of Fermilab Welding Procedures and Welder Qualifications for non-Fermilab work shall be at the sole risk and responsibility of the Subcontractor, and the Subcontractor shall indemnify and save Fermilab and the government harmless from any and all claims, demands, actions or causes of action, and for any expense or loss by reason of Subcontractor's and their employees possession and use of Fermilab procedures and qualifications.